



TYPICAL SECTION - EROSION BARRIER  
NO SCALE


NOTE: THIS CONSTRUCTION FOR CLAY TREATMENT ONLY. IF VINYL FILM USED, SEE DETAIL LOWER CENTER THIS SHEET.

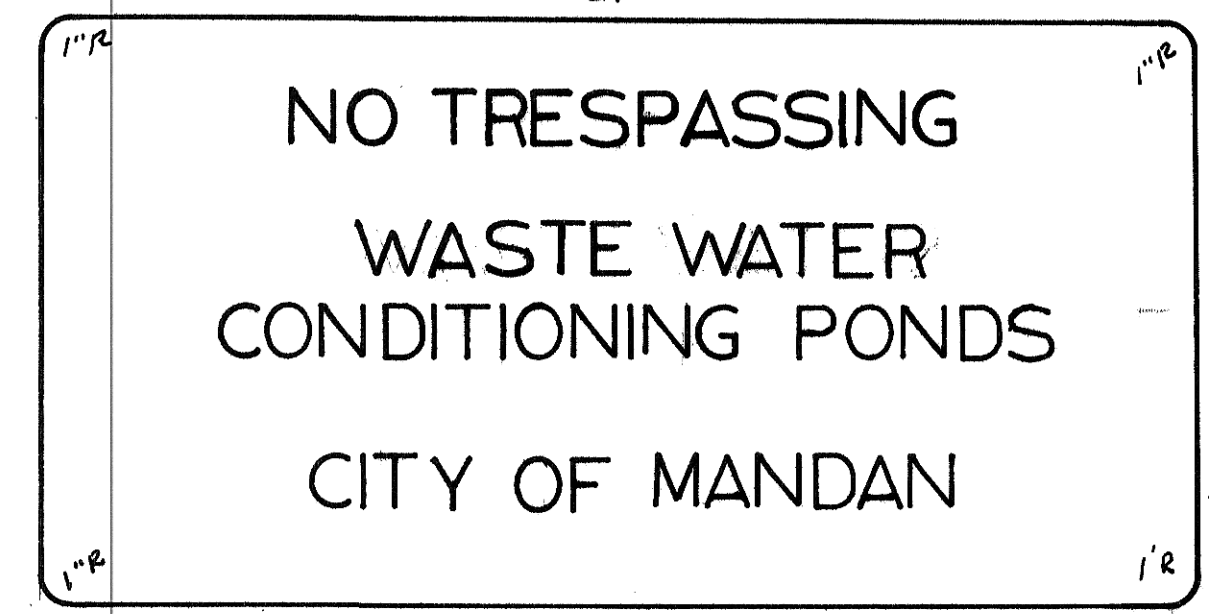


TYPICAL WARNING SIGN  
SCALE 1/4" = 1"

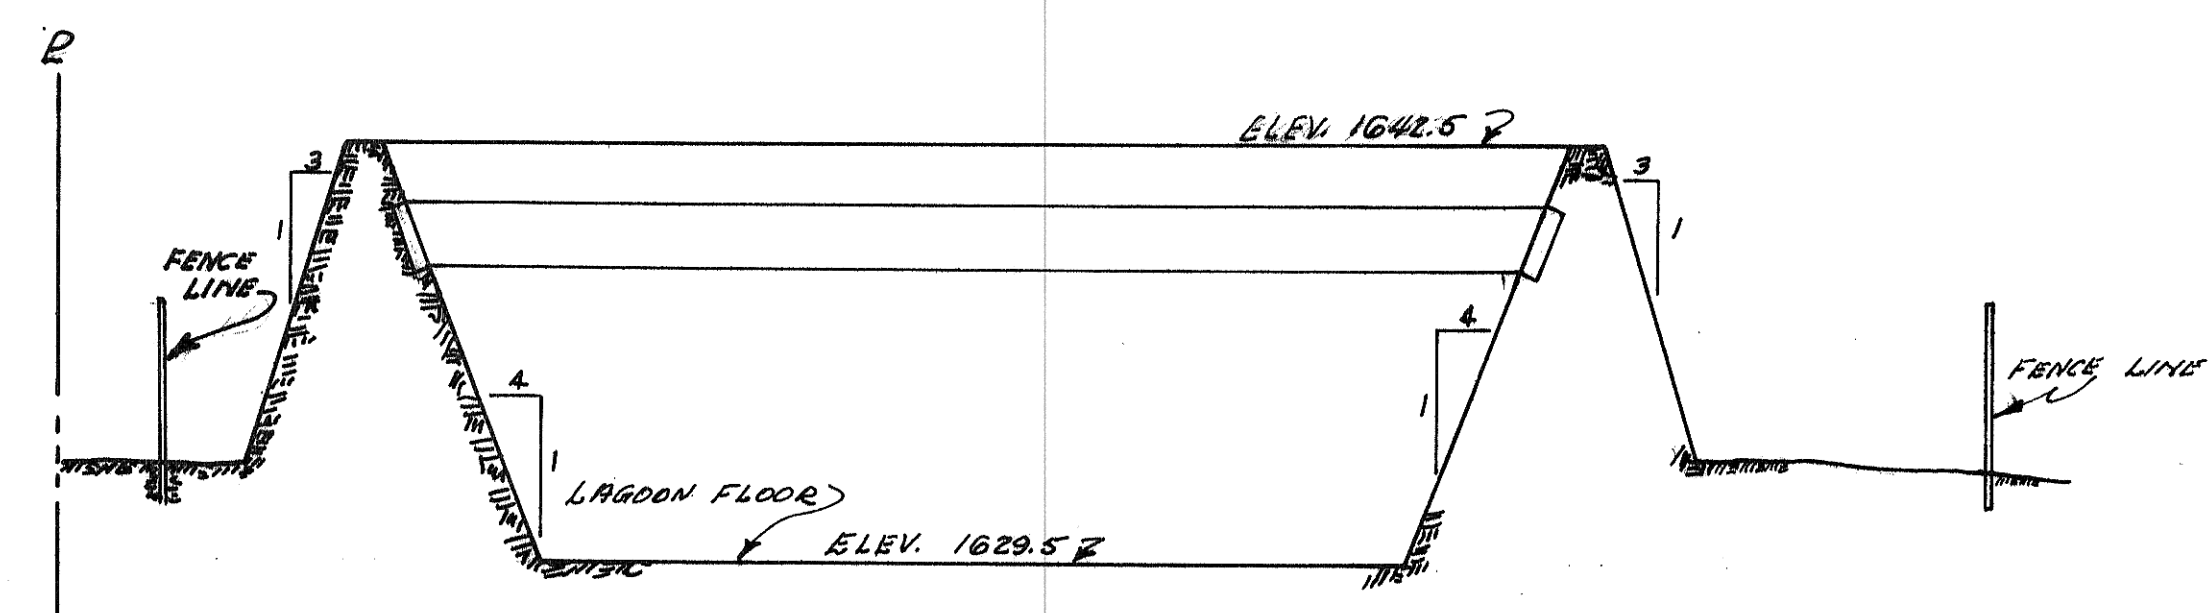


SECTION B-B

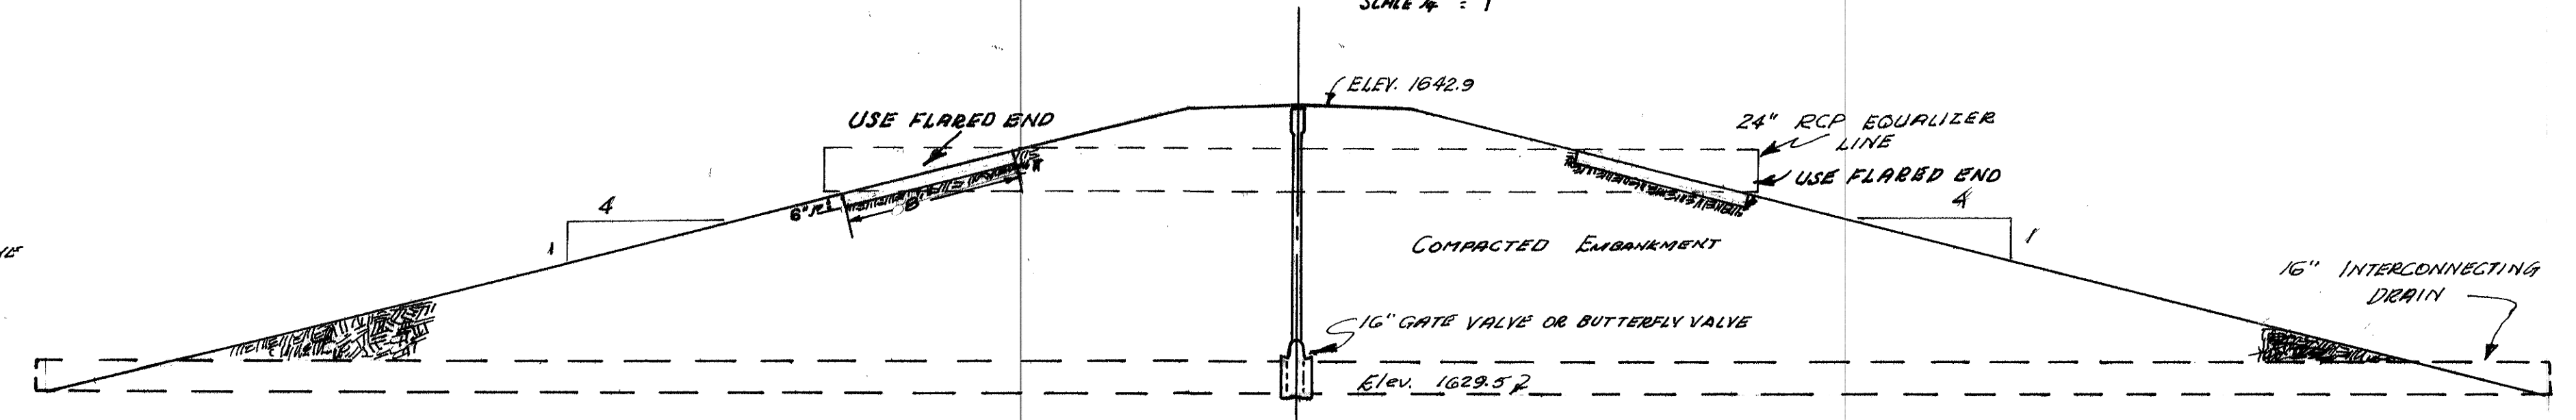


DETAIL - CENTER DIKE

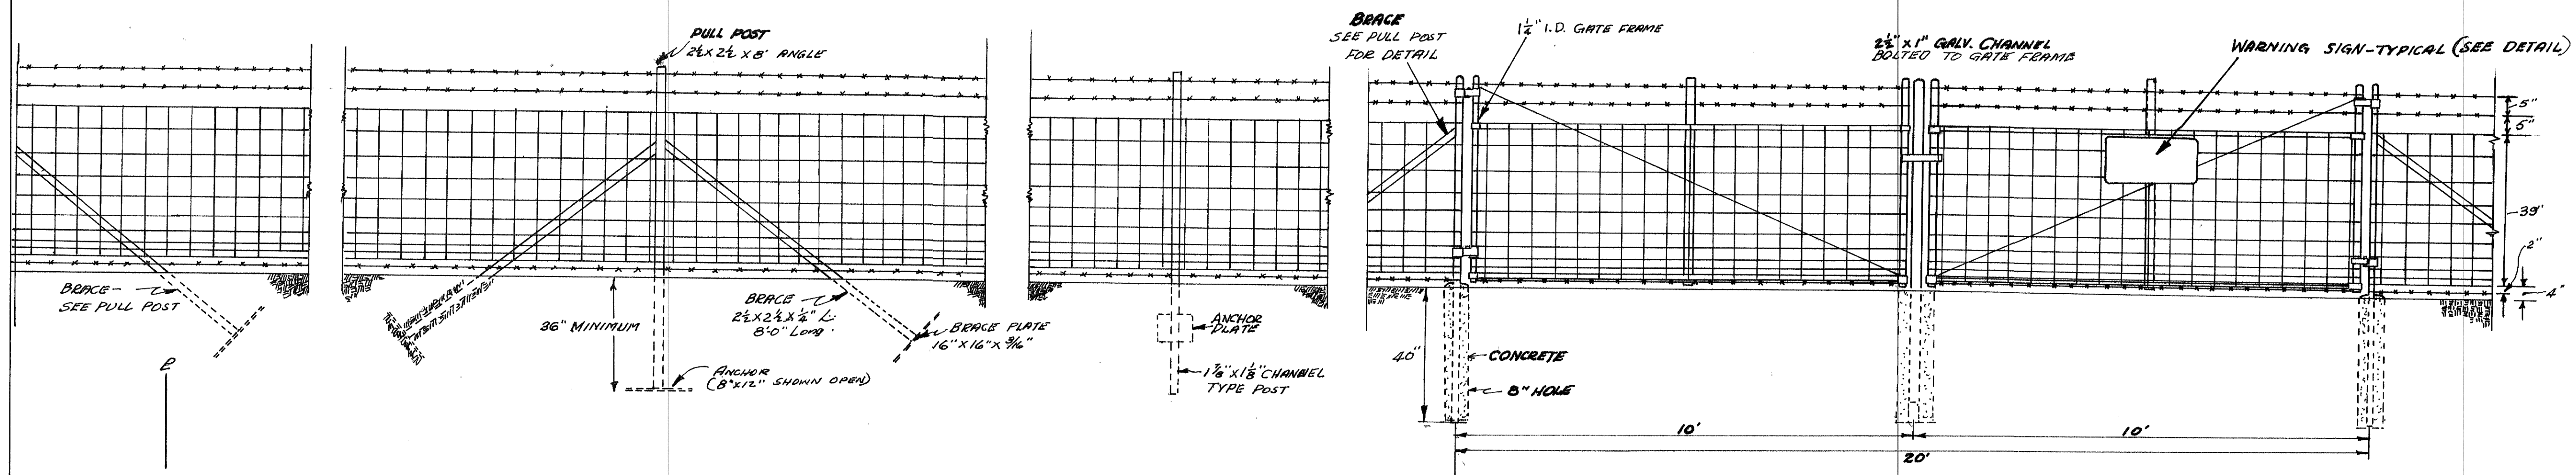

SECTION A-A

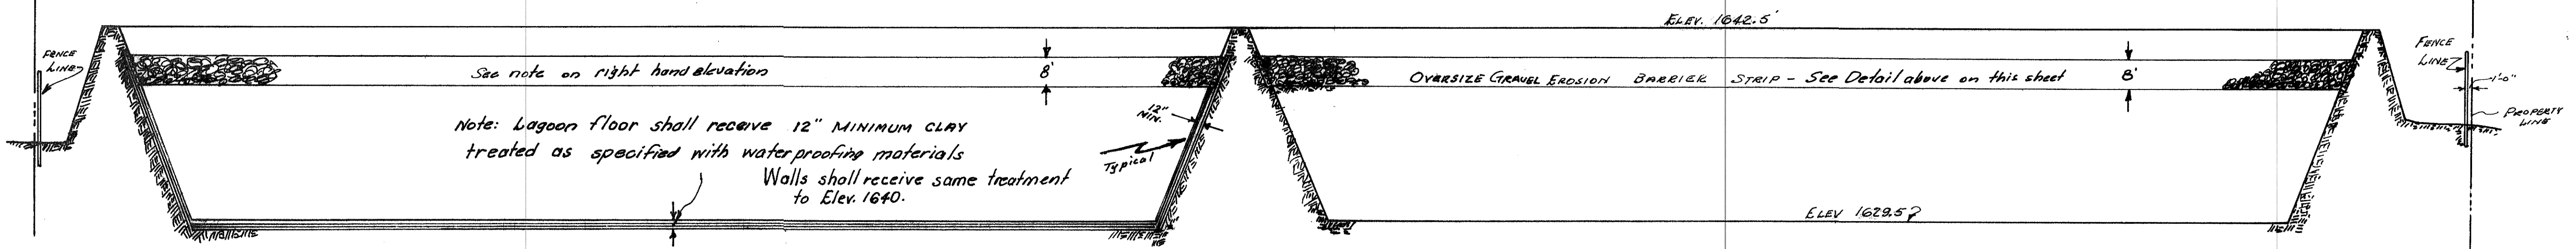


Note: Lagoon floor shall receive 12" MINIMUM CLAY treated as specified with waterproofing materials. Walls shall receive same treatment to Elev. 1640.

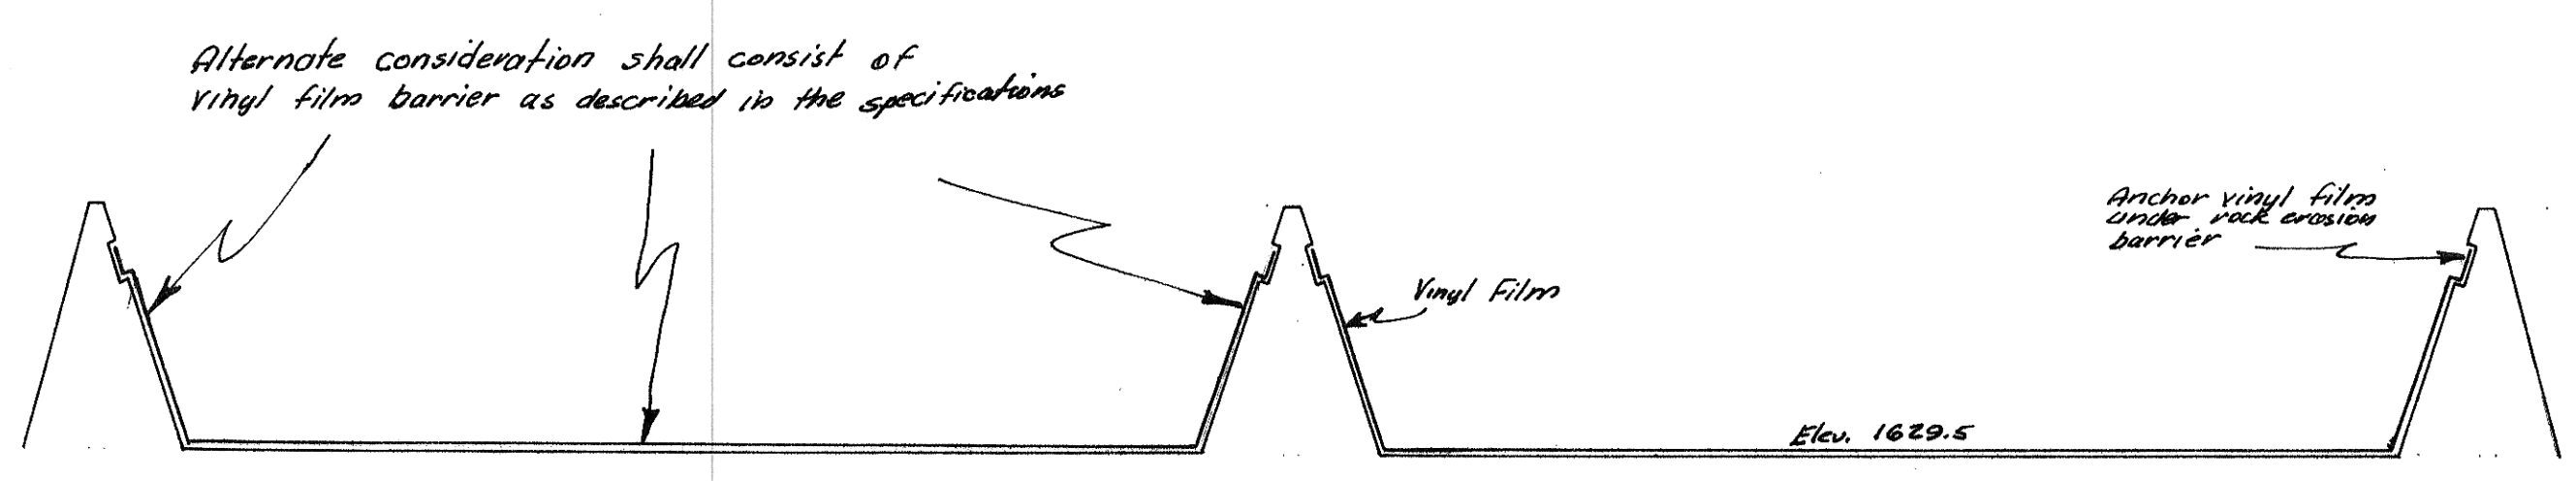

SECTION A-A  
(ALTERNATE CONSIDERATION)

SCALE  
HOR 1" = 120'  
VERT 1" = 10'

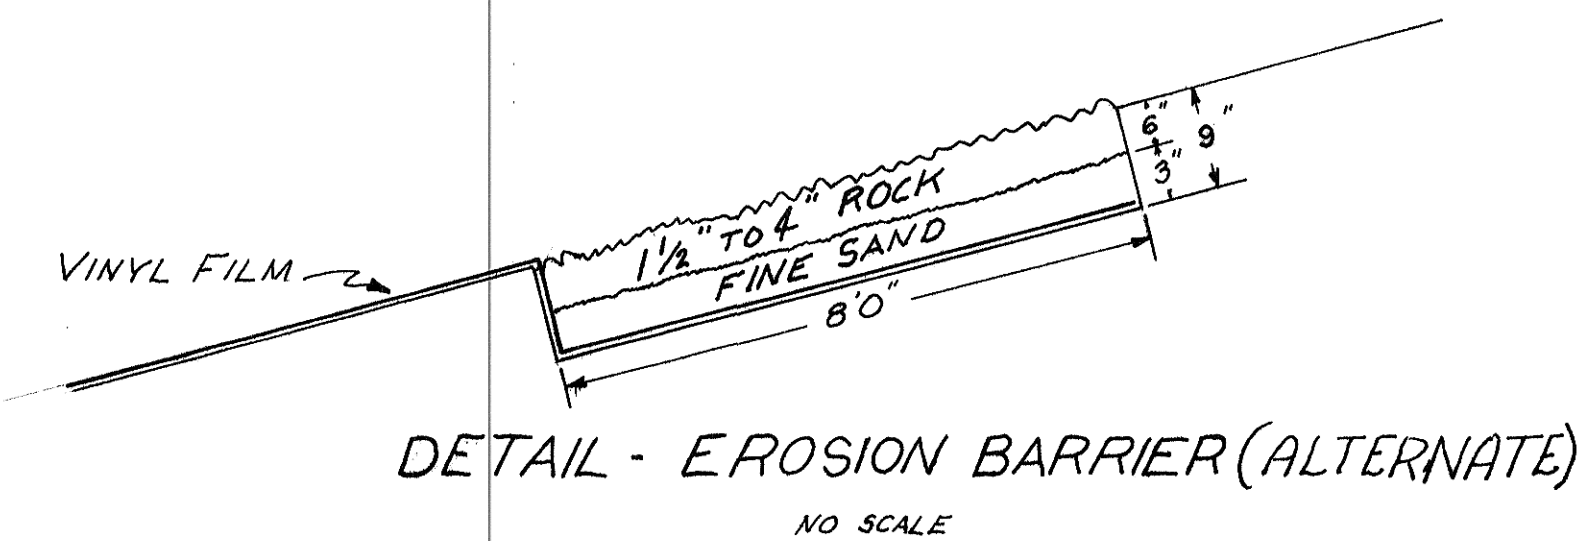

DETAIL - EROSION BARRIER (ALTERNATE)  
NO SCALE

REVISED  
Date: 16 September 1966  
**DESTROY**  
PREVIOUS EDITIONS  
GEORGE J. TOMAN  
Consulting Engineer



Job	SANITARY SEWER IMPROVEMENT DISTRICT NO. 14 CITY OF MANDAN NORTH DAKOTA	
File No.	Date: 3 August 1966	Revised: 16 September 1966
SHEET NO. 21 OF 27 SHEETS		
SCALE:		
Drawn By: B.L.	Checked By: <i>[Signature]</i>	
GEORGE TOMAN R. P. E. NO. 185		CONSULTING ENGINEER MANDAN, NORTH DAKOTA